




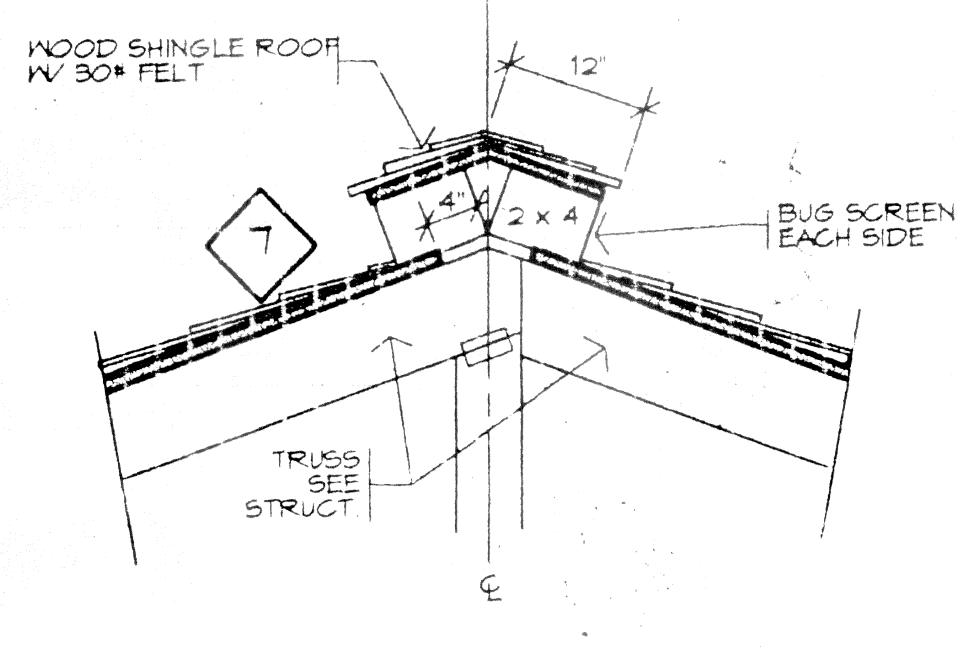


1 RIDGE VENT
@ 3/4" = 1'-0" 93184

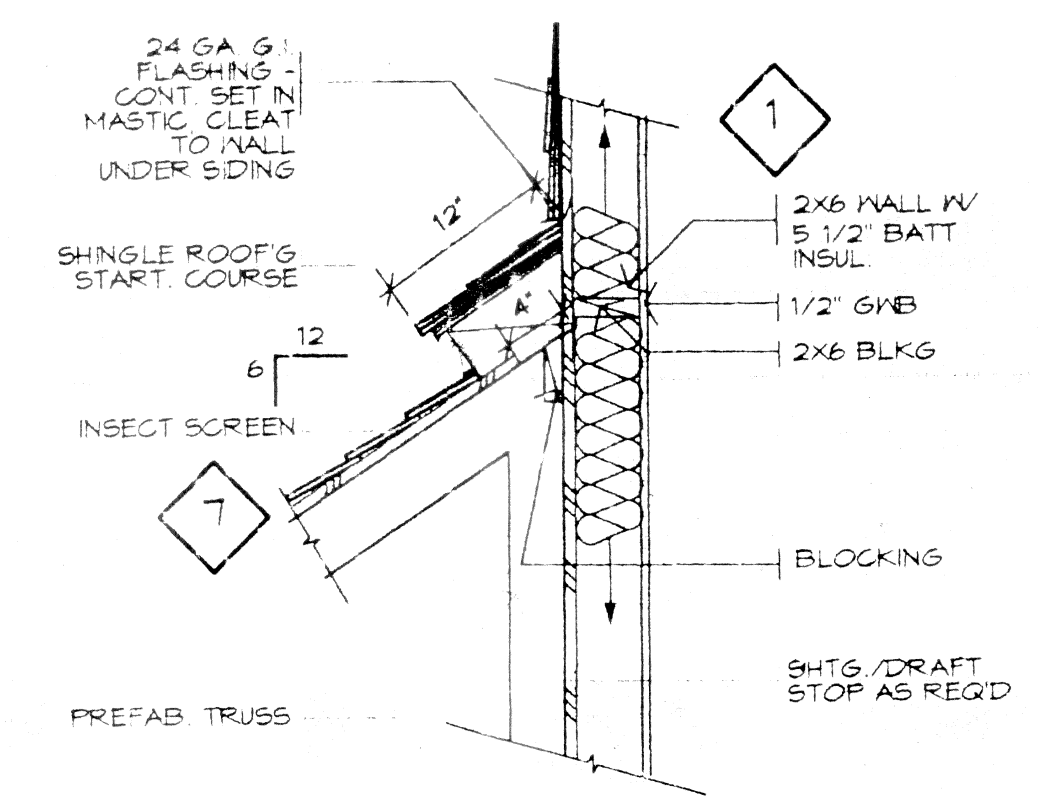

2 ATTIC VENT @ WALL
@ 3/4" = 1'-0" 93184

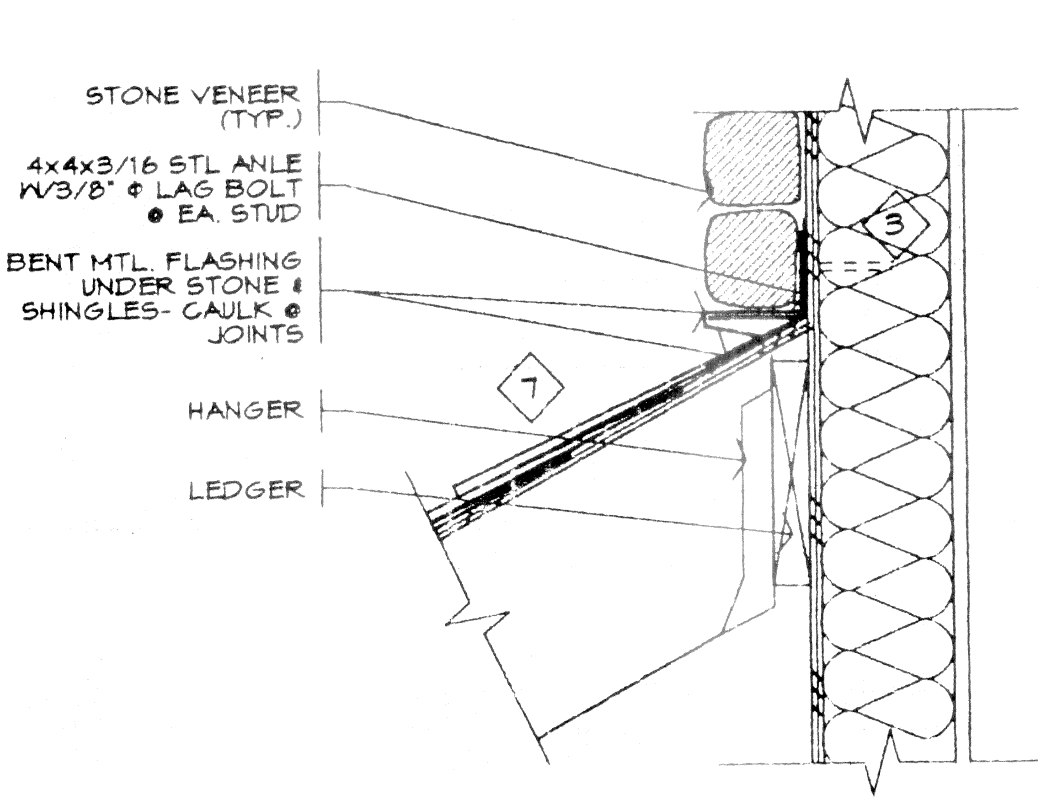


3 STONE OVER ENTRY ROOF
@ 1 1/2" = 1'-0" 94103

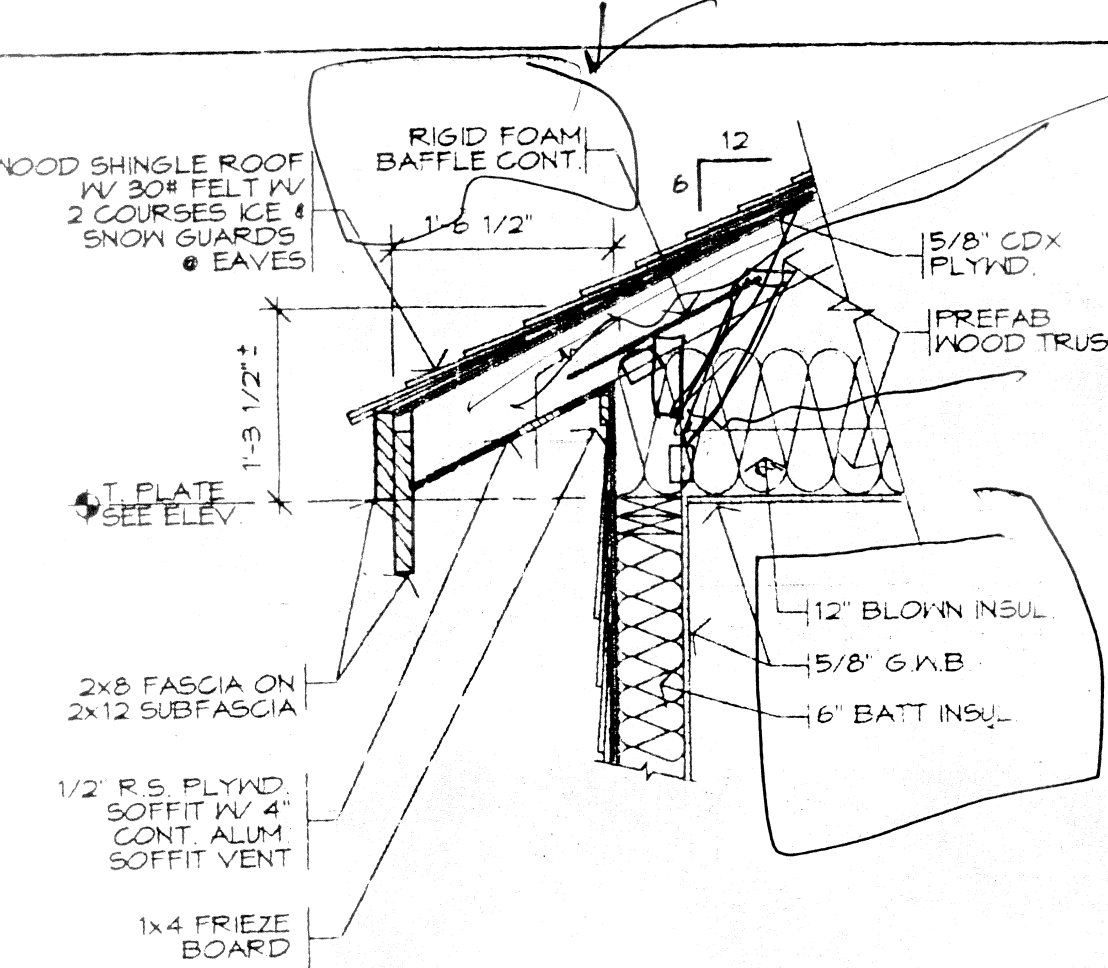


4 TYP. ROOF OVERHANG
@ 3/4" = 1'-0" 93184

CONSTRUCTION TYPES:


- 1 Exterior Wall 1 - Cedar Siding
- 7 #1 Kraft sheathing paper, lap 2" horiz. and 6" vert.
- 1/2" fiberboard sheathing typical with 1/2" plywood where required by
- 2x6 studs 24" o.c. with 6" batts
- 4 mil vapor barrier, overlap 1 framing member plus 1"
- 5/8" GNB
- 2 Exterior Wall 2 - 16" cedar shingles 6" to weather. Soffit batts
- 7 #1 Kraft sheathing paper, lap 2" horiz. and 6" vert.
- 1/2" plywood sheathing, or approved fiberboard nail base (nail shingles with ring shank nails)
- 3 Exterior Wall 3 - 4" stone veneer including 1" slush in mortar
- 7 #1 Kraft sheathing paper, lap 2" horiz. and 6" vert.
- 3/4" x 22 ga anchor ties 1 per/ 2 sq. ft. Attach to studs
- 1/2" fiberboard sheathing typical with 1/2" plywood where required by structural
- 2x6 studs 16" o.c. with 6" batts
- 4 mil vapor barrier, overlap 1 framing member plus 1"
- 5/8" GNB
- 4 Party Wall 4 - 5/8" GNB
- 2x4 studs 16" o.c. with 5 1/2" batts
- 5/8" GNB fire taped only
- 1/4" airspace IMPORTANT: partitions must not touch
- 5/8" GNB fire taped only
- 2x4 studs 24" o.c. with 5 1/2" batts
- 5/8" GNB fire taped only
- NOTE: Do not plumb in this wall
- stagger electrical outlet boxes 1 stud space minimum, do not remove batts at boxes
- No penetrations between units above lower level floor joists or below 12" above upper level ceiling. All penetrations must be sealed airtight.
- 5 Int./Garage Wall 5 - 5/8" GNB
- 5 1/2" studs 16" o.c.
- 4 mil vapor barrier
- 5/8" GNB (interior)
- 6 Interior Wall 6 - 5/8" GNB
Typical U.N.D. - 2x4 studs (2x6) for Brg walls w/ plumbing
- 5/8" GNB
- 7 Roof/Ceiling 7 - 5/8" GNB
- 4 mil vapor barrier
- 6 in 12 prefabricated roof trusses
- R-30 blown in insulation
- 5/8" plywood sheathing
- 2 courses ice and snow guard at eaves
- 30x100 underlayment starter course and interlayment over entire roof
- cedar shakes
- 8 Floor/Ceiling 8 - 5/8" GNB
at Garage - 14" T.J.s at 16" o.c.
at Garage - R-19 batts (all face down) air space down
- 3/4" T&G plywood ring shank nail and glue
- 9 Floor/Ceiling 9 - 5/8" GNB
Typ Int. - 9 1/2" T.J.s at 16" o.c.
- 3/4" T&G plywood ring shank nail and glue
- 10 Concrete Slab 10 - 4" conc. slab
- compacted gran. subbase
- compacted subgrade

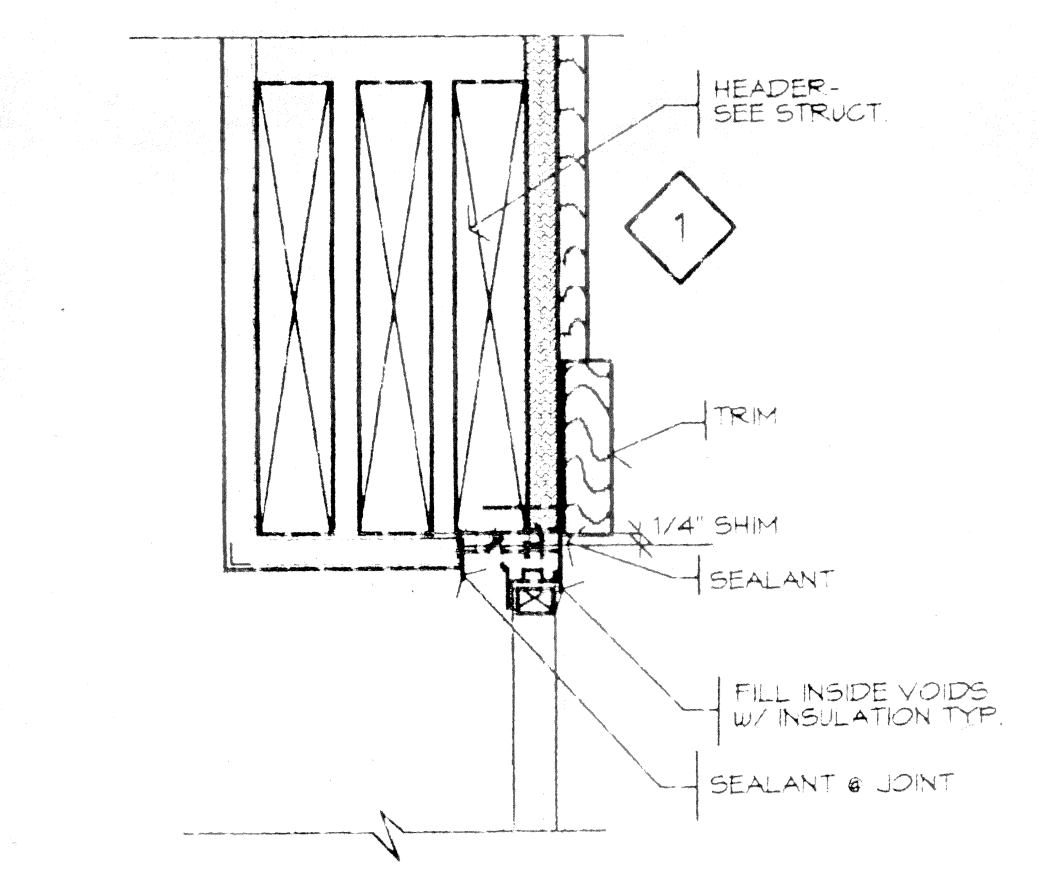


5 WINDOW HEADER
@ 3" = 1'-0" 93184

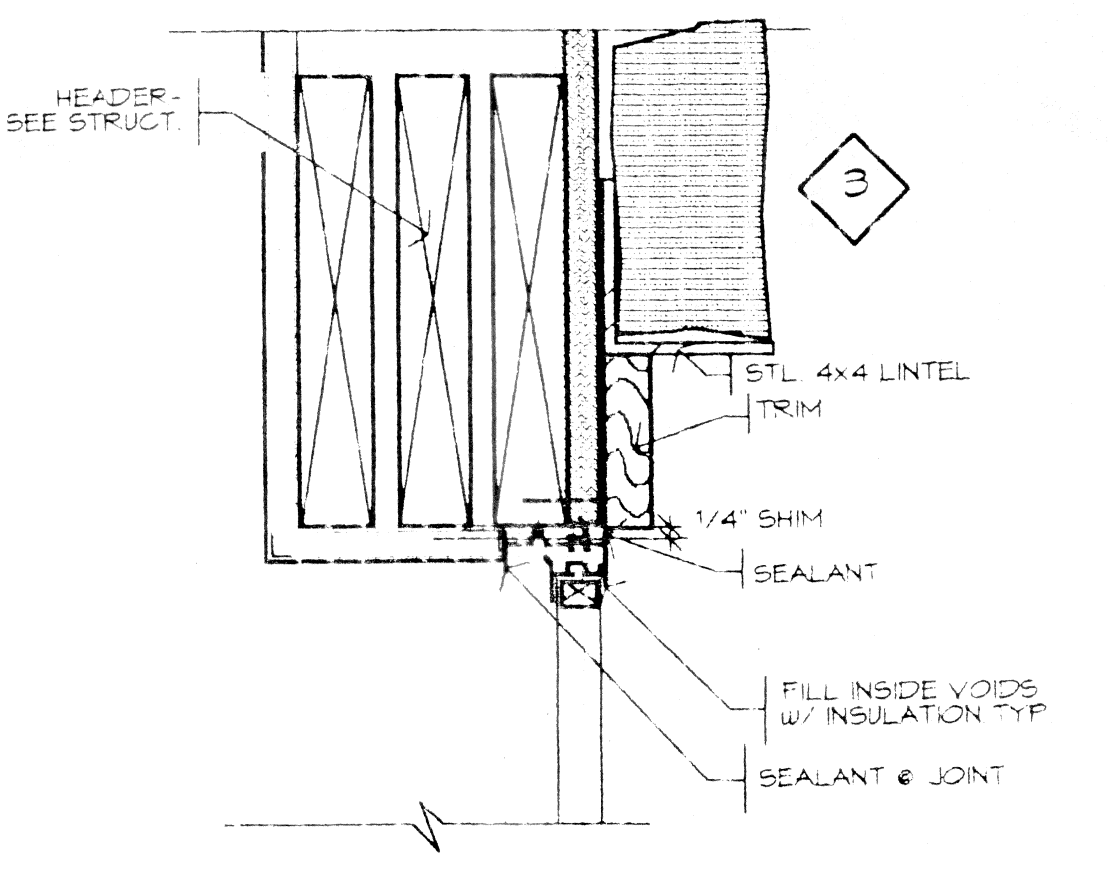


6 WDN HEADER @ STONE
@ 3" = 1'-0" 93184

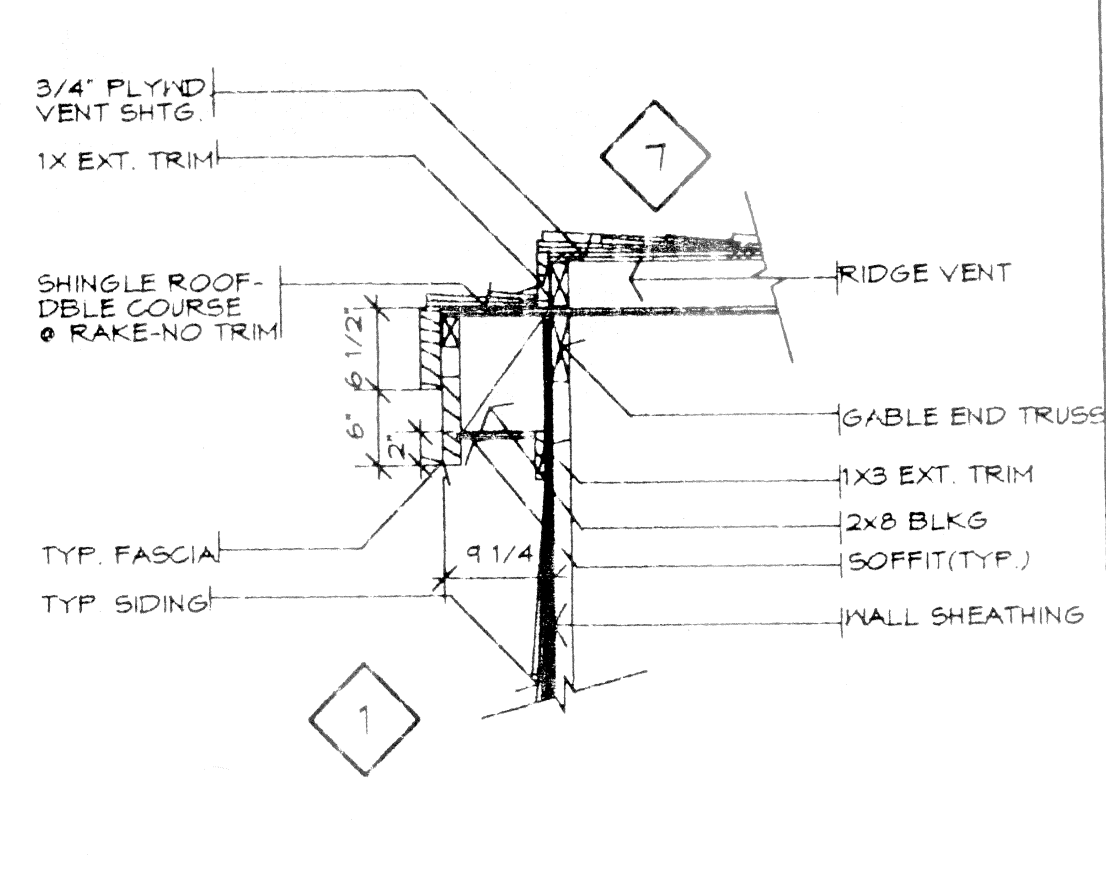


7 TYP. FASCIA @ GABLE END
@ 3/4" = 1'-0" 93184

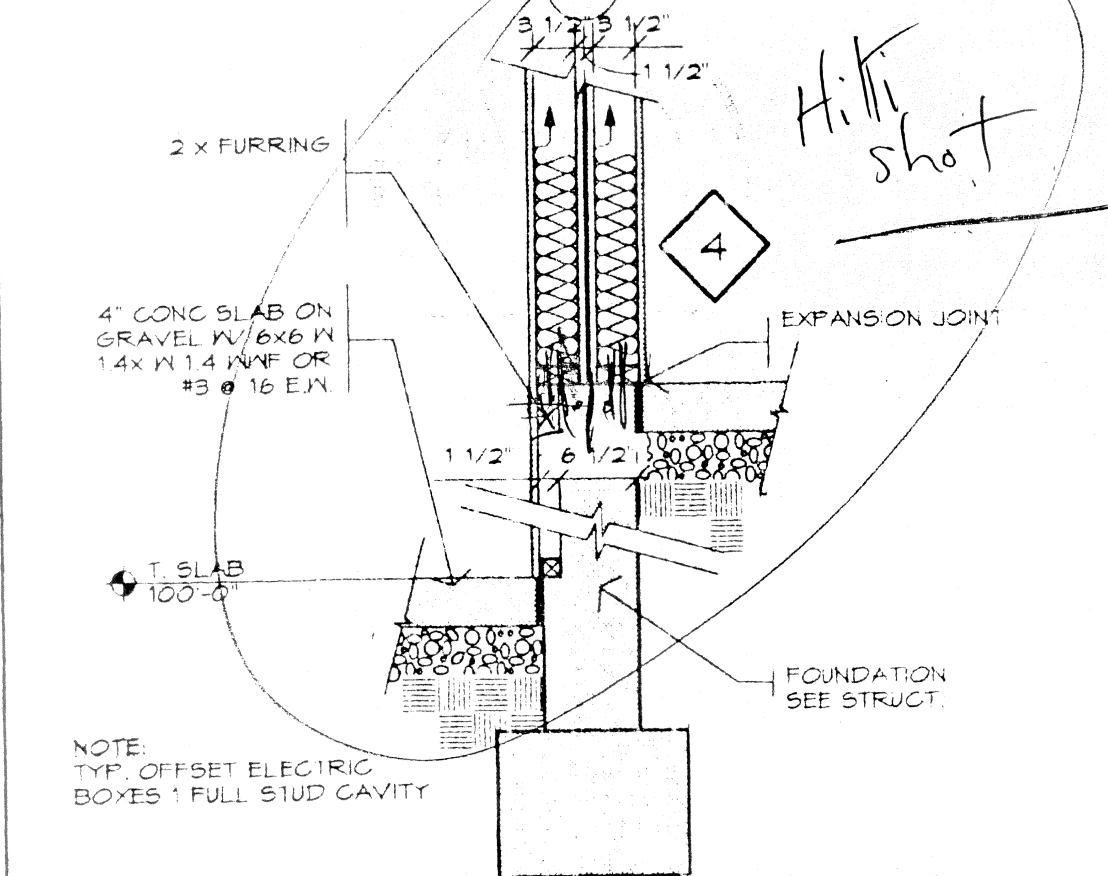


8 FND. @ PARTY WALL
@ 3/4" = 1'-0" 93184

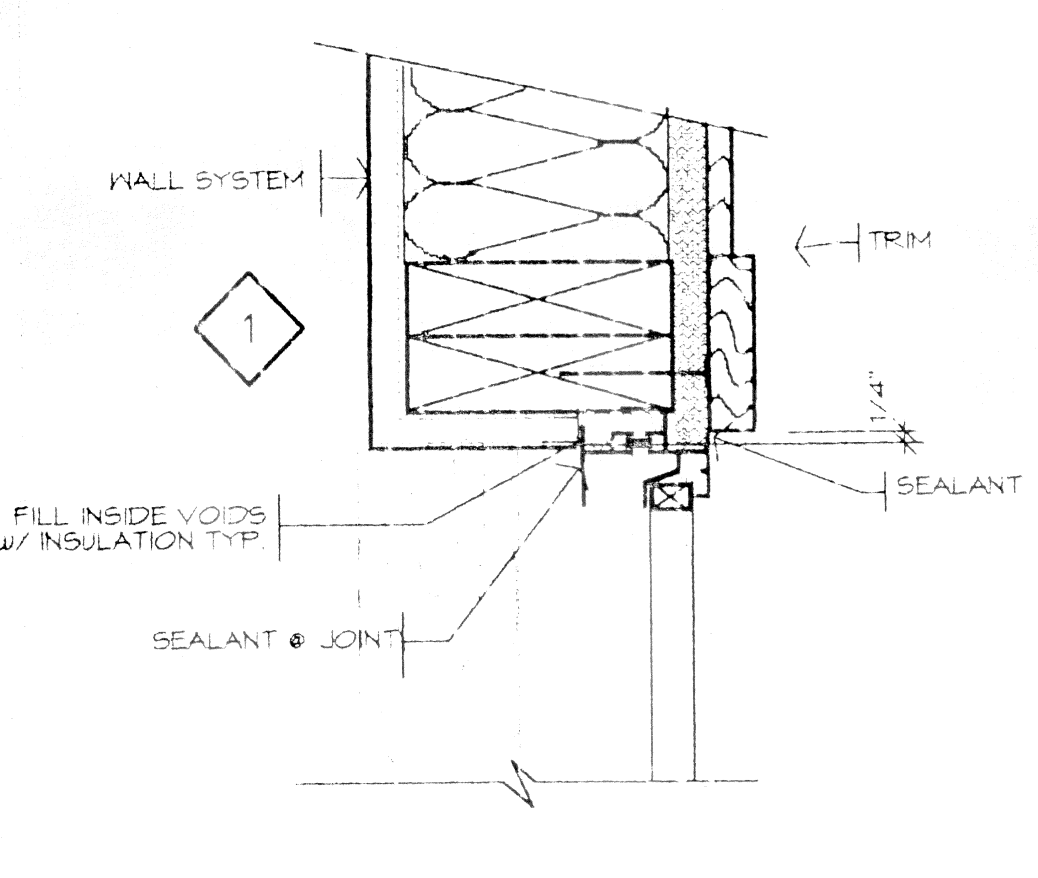


9 WINDOW JAMB
@ 3" = 1'-0" 93184

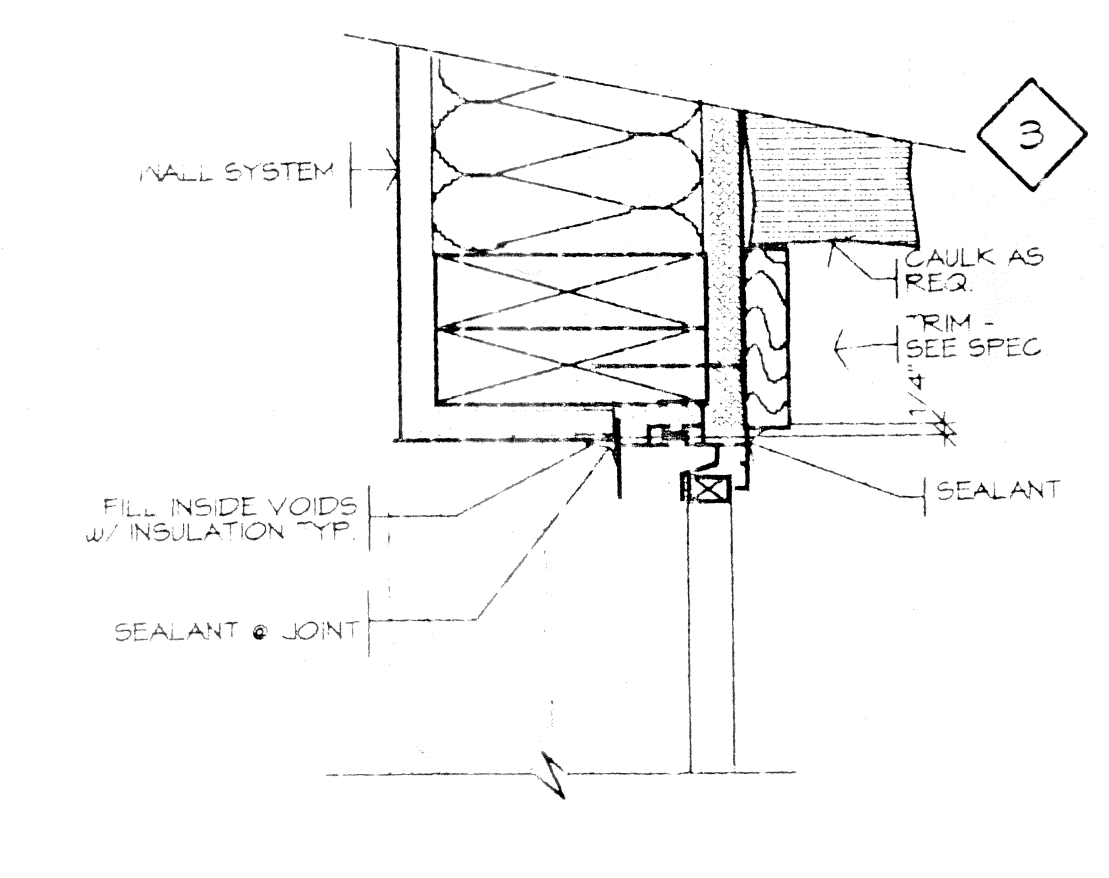


10 WDN JAMB @ STONE
@ 3" = 1'-0" 93184

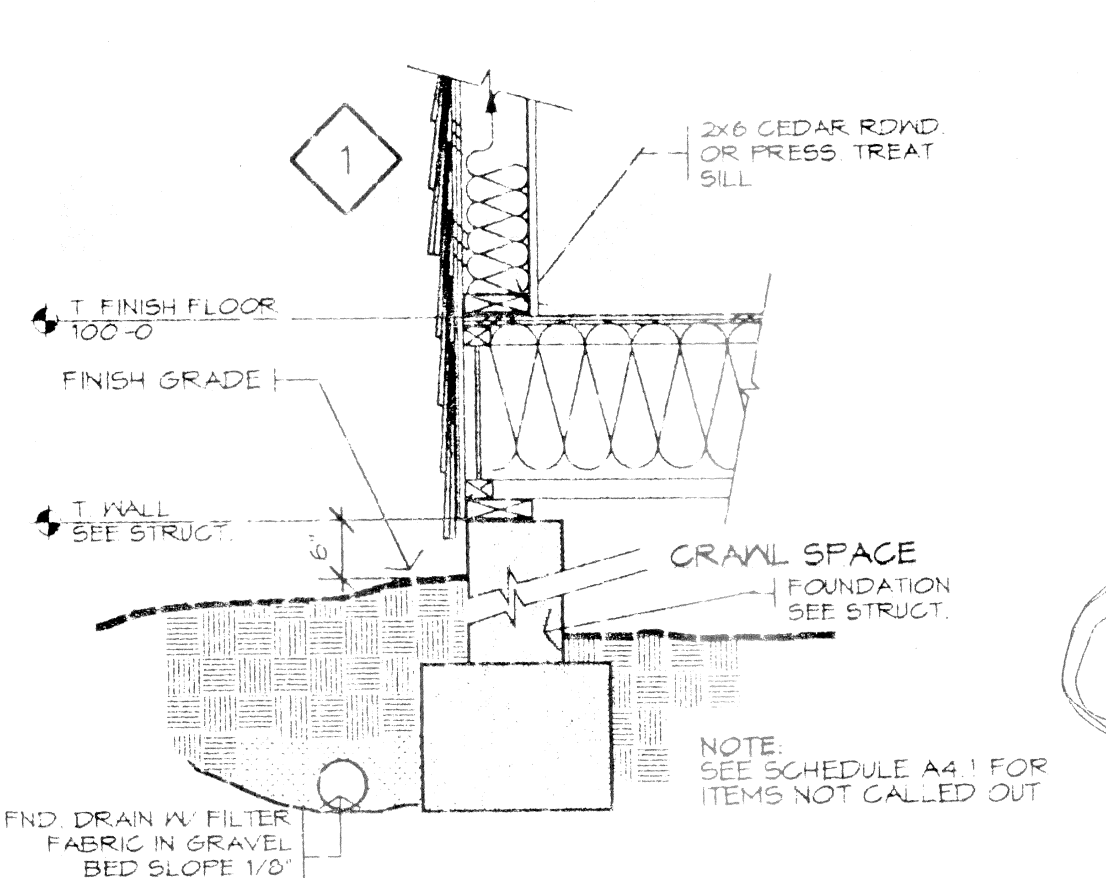


11 FND. @ CRAWL SPACE
@ 3/4" = 1'-0" 93184

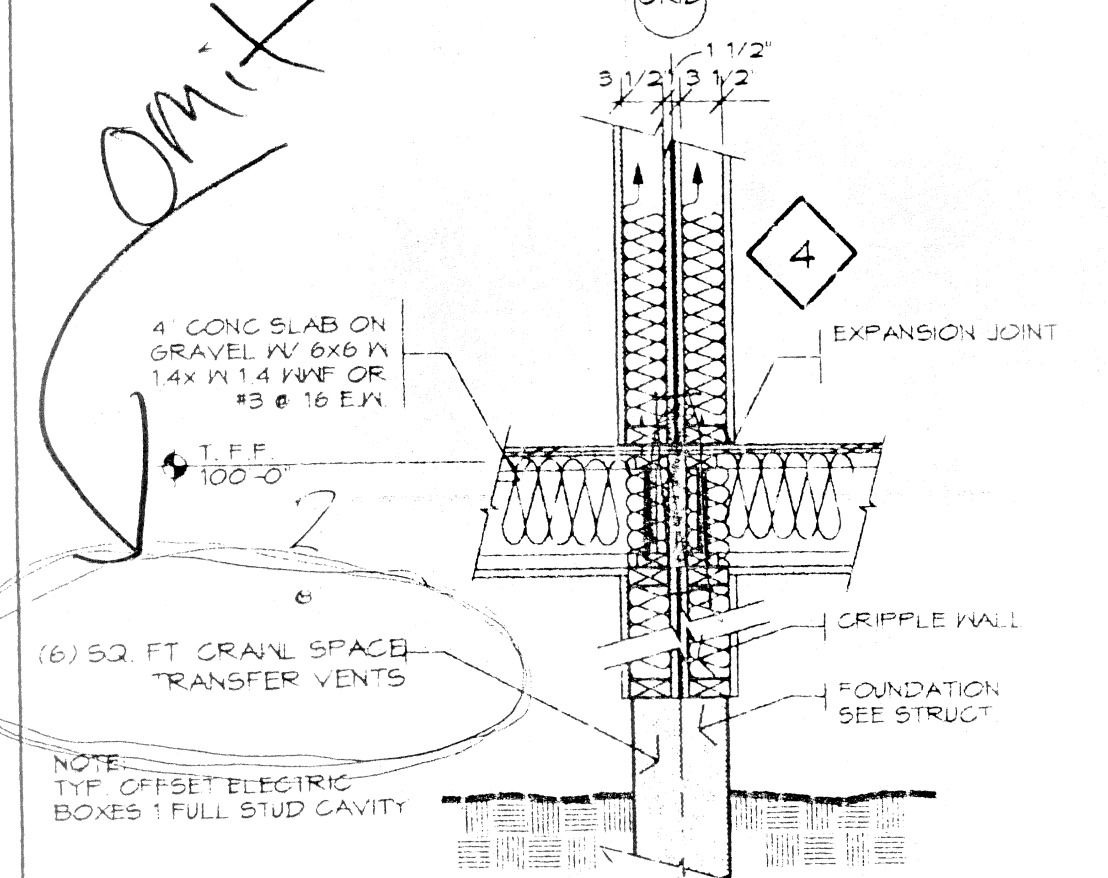


12 FND. @ PARTY WALL
@ 3/4" = 1'-0" 93184

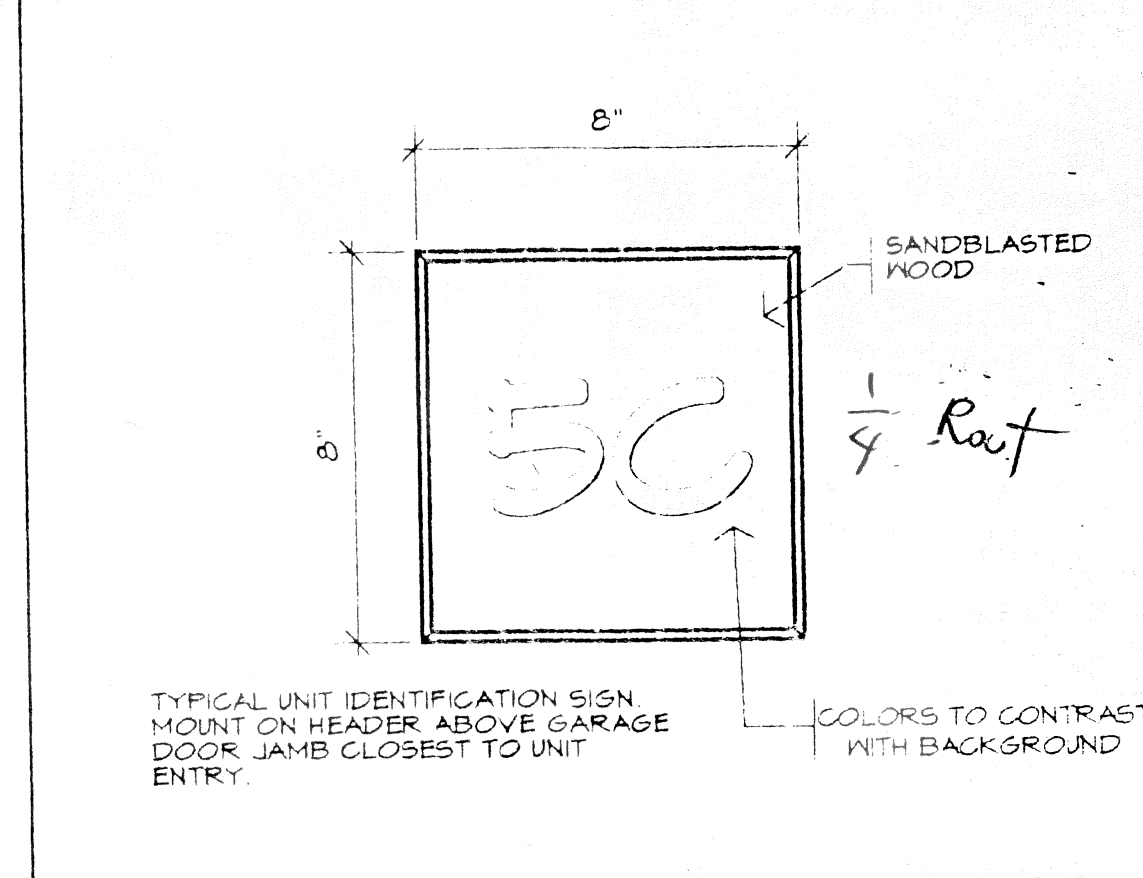


13 UNIT SIGN DETAIL
@ 3" = 1'-0" 93184

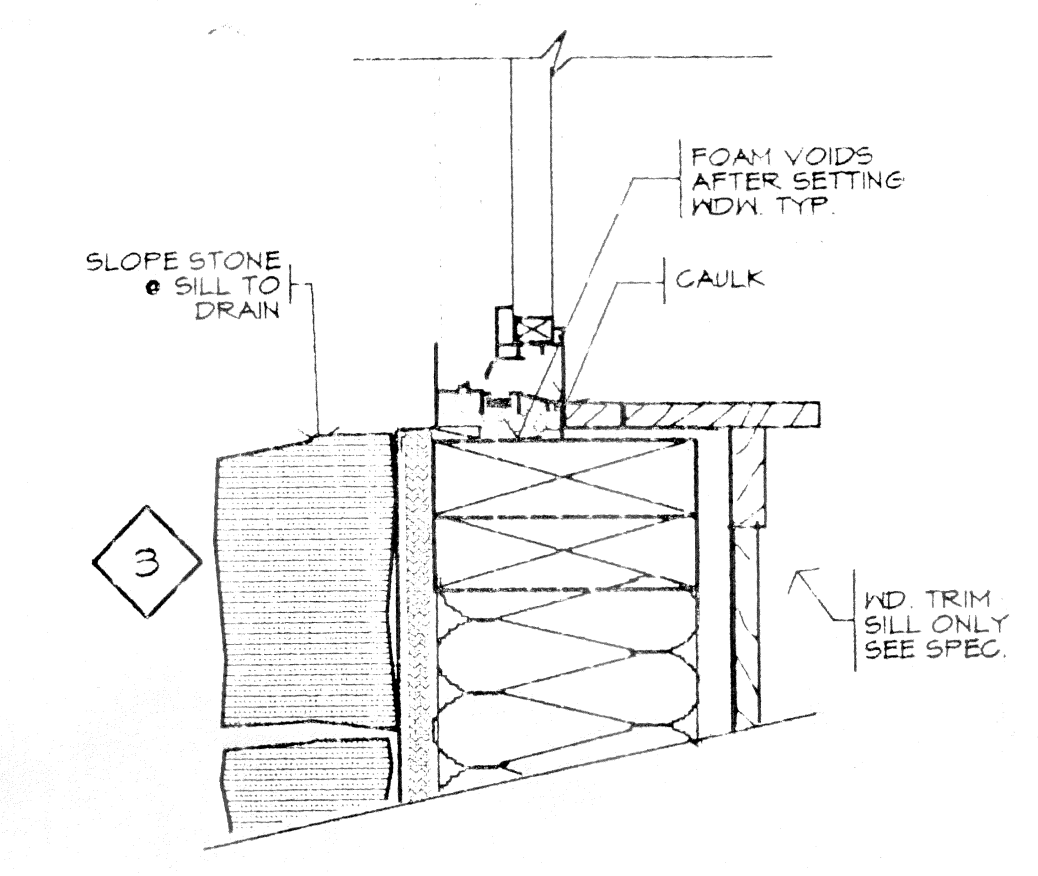


14 WINDOW SILL @ STONE
@ 3" = 1'-0" 93184

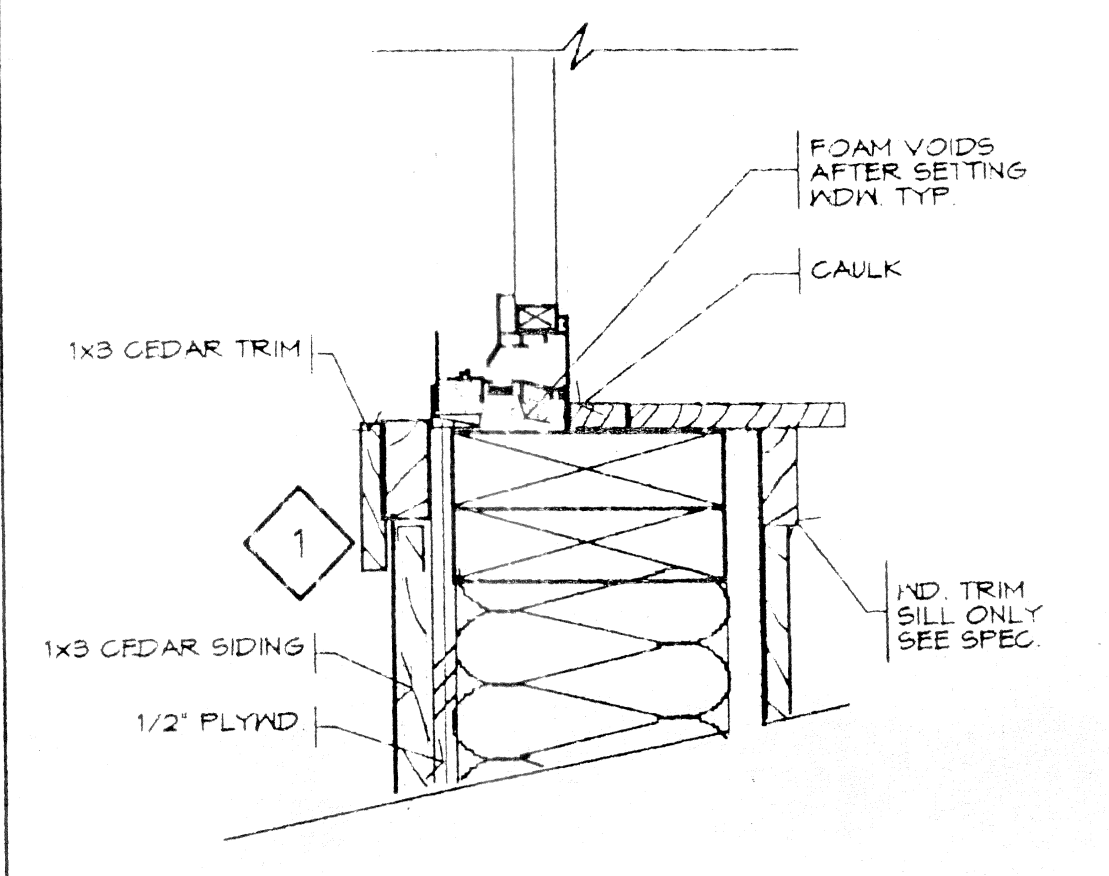


15 WINDOW SILL @ SIDING
@ 3" = 1'-0" 93184

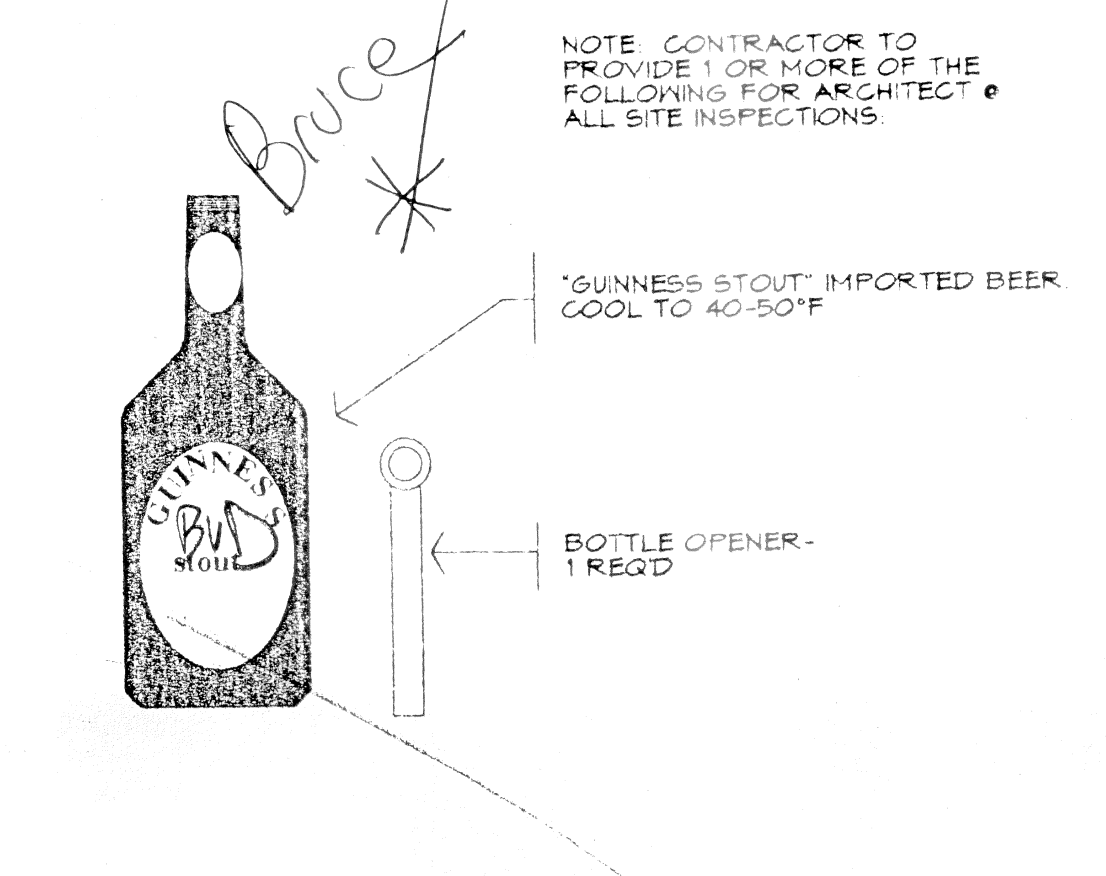


16 PROVISIONS
@ 1 1/2" = 1'-0" 93184

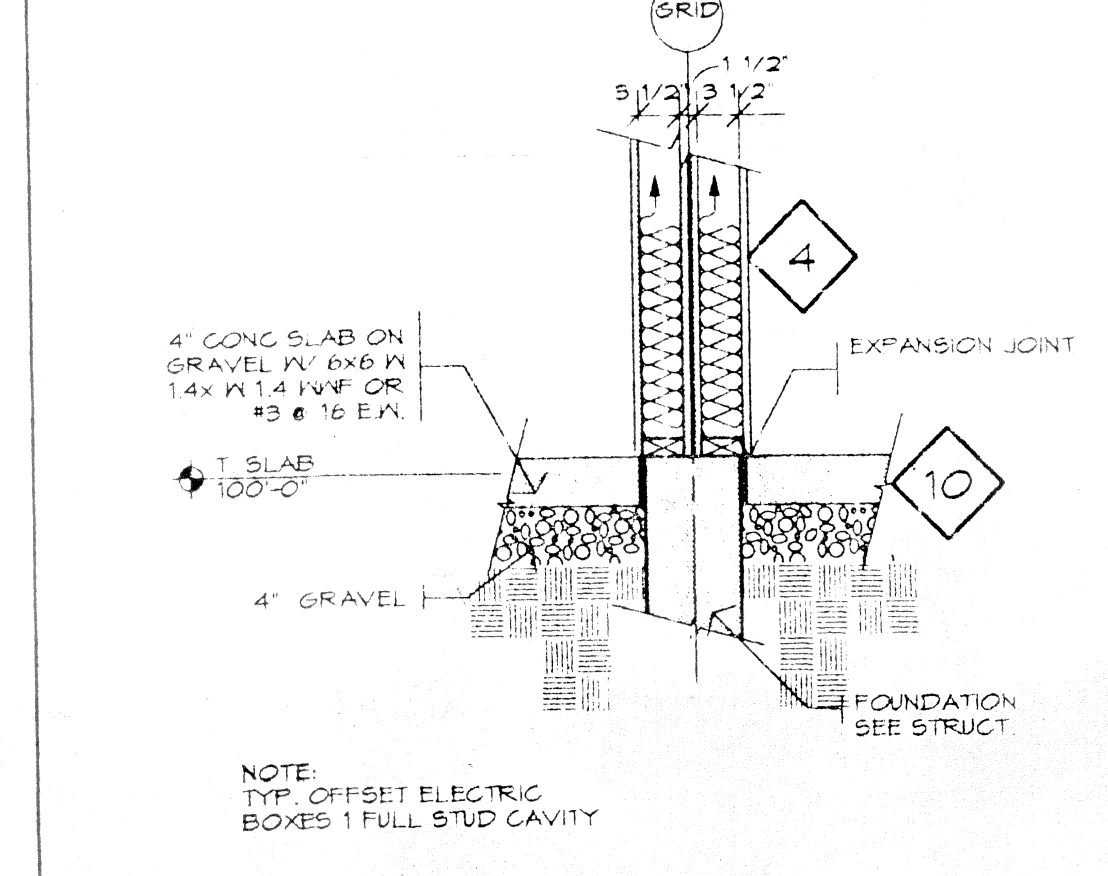

17 FND. @ PARTY WALL
@ 3/4" = 1'-0" 93184

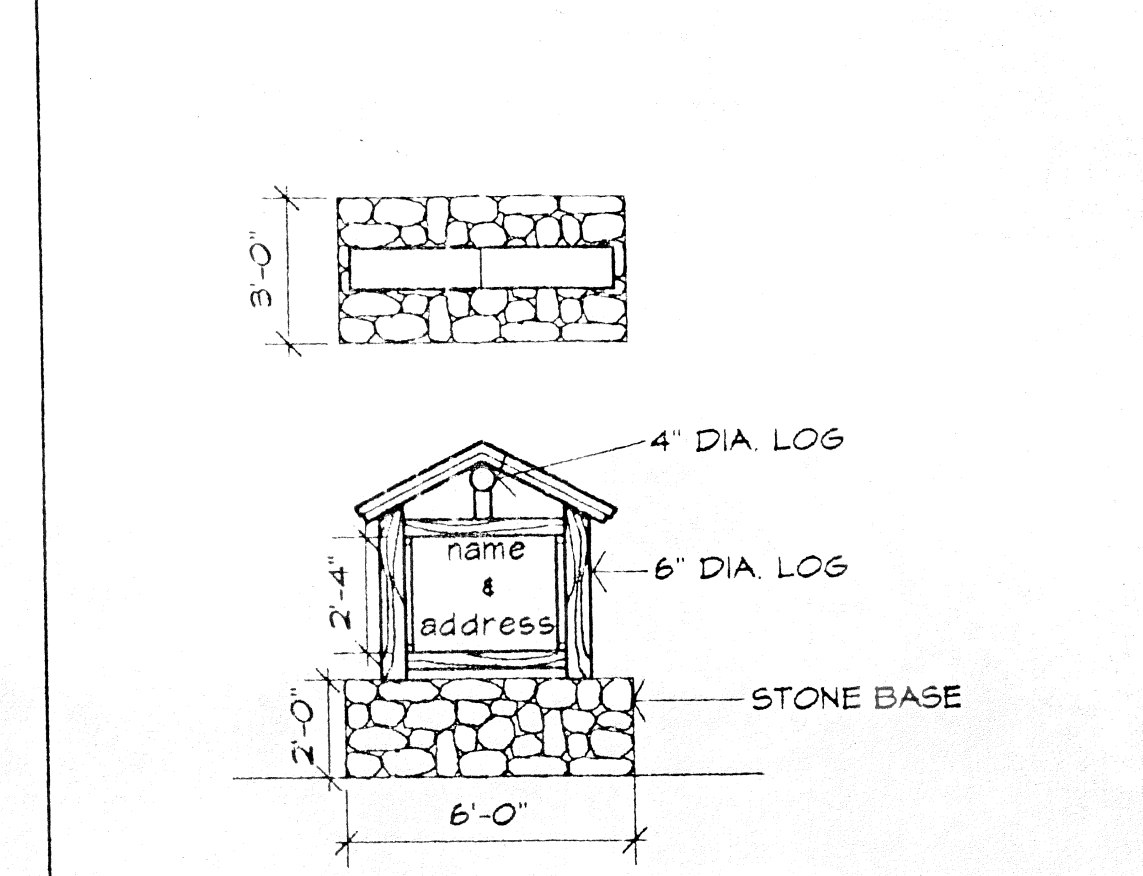


18 PROJECT SIGN DETAIL
@ 1/4" = 1'-0" 93184

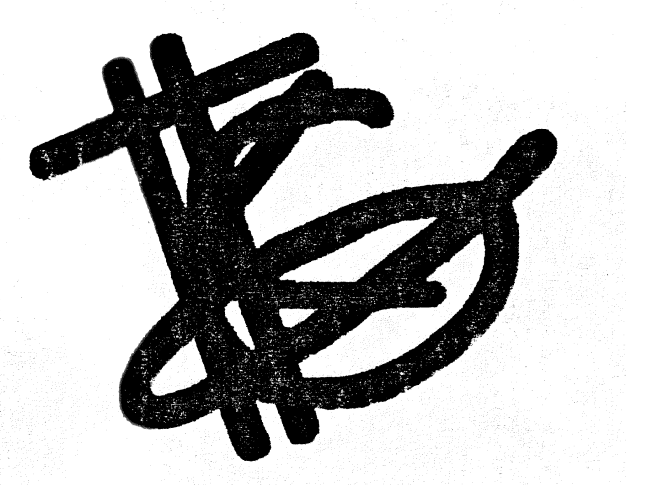

THEODORE K GUY
ASSOCIATES PC

ARCHITECTS AND
STRUCTURAL ENGINEERS

P.O. BOX 1640
23280 HWY. 82
BASALT, COLORADO 81621
PHONE (303) 927-3161
FAX (303) 927-4813

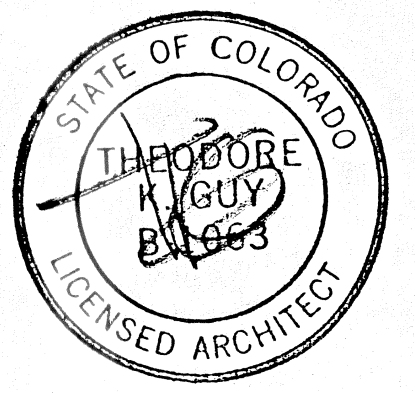

DATE 4-3-94 REMARKS PERMIT SET

MOUNTAIN
HOUSING GROUP

LOT 640C
TELLURIDE MOUNTAIN VILLAGE

JOB #: 93184
DRAWN: RKO
CHECKED:
PRINTED: 3-14-94

SHEET TITLE:
ARCHITECTURAL DETAILS

A5.1

COPYRIGHT
THEODORE K GUY ASSOCIATES PC